




PanaCast 50

Wall Mount

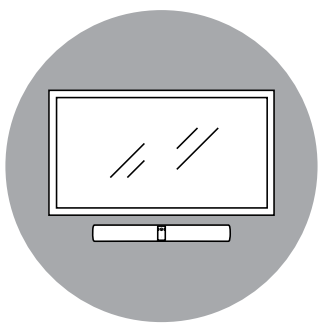


Install below screen

Start from page 1 →

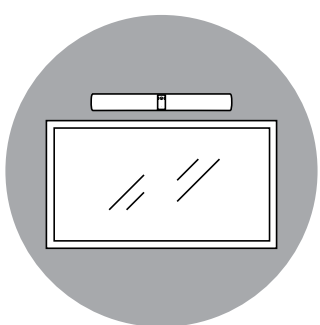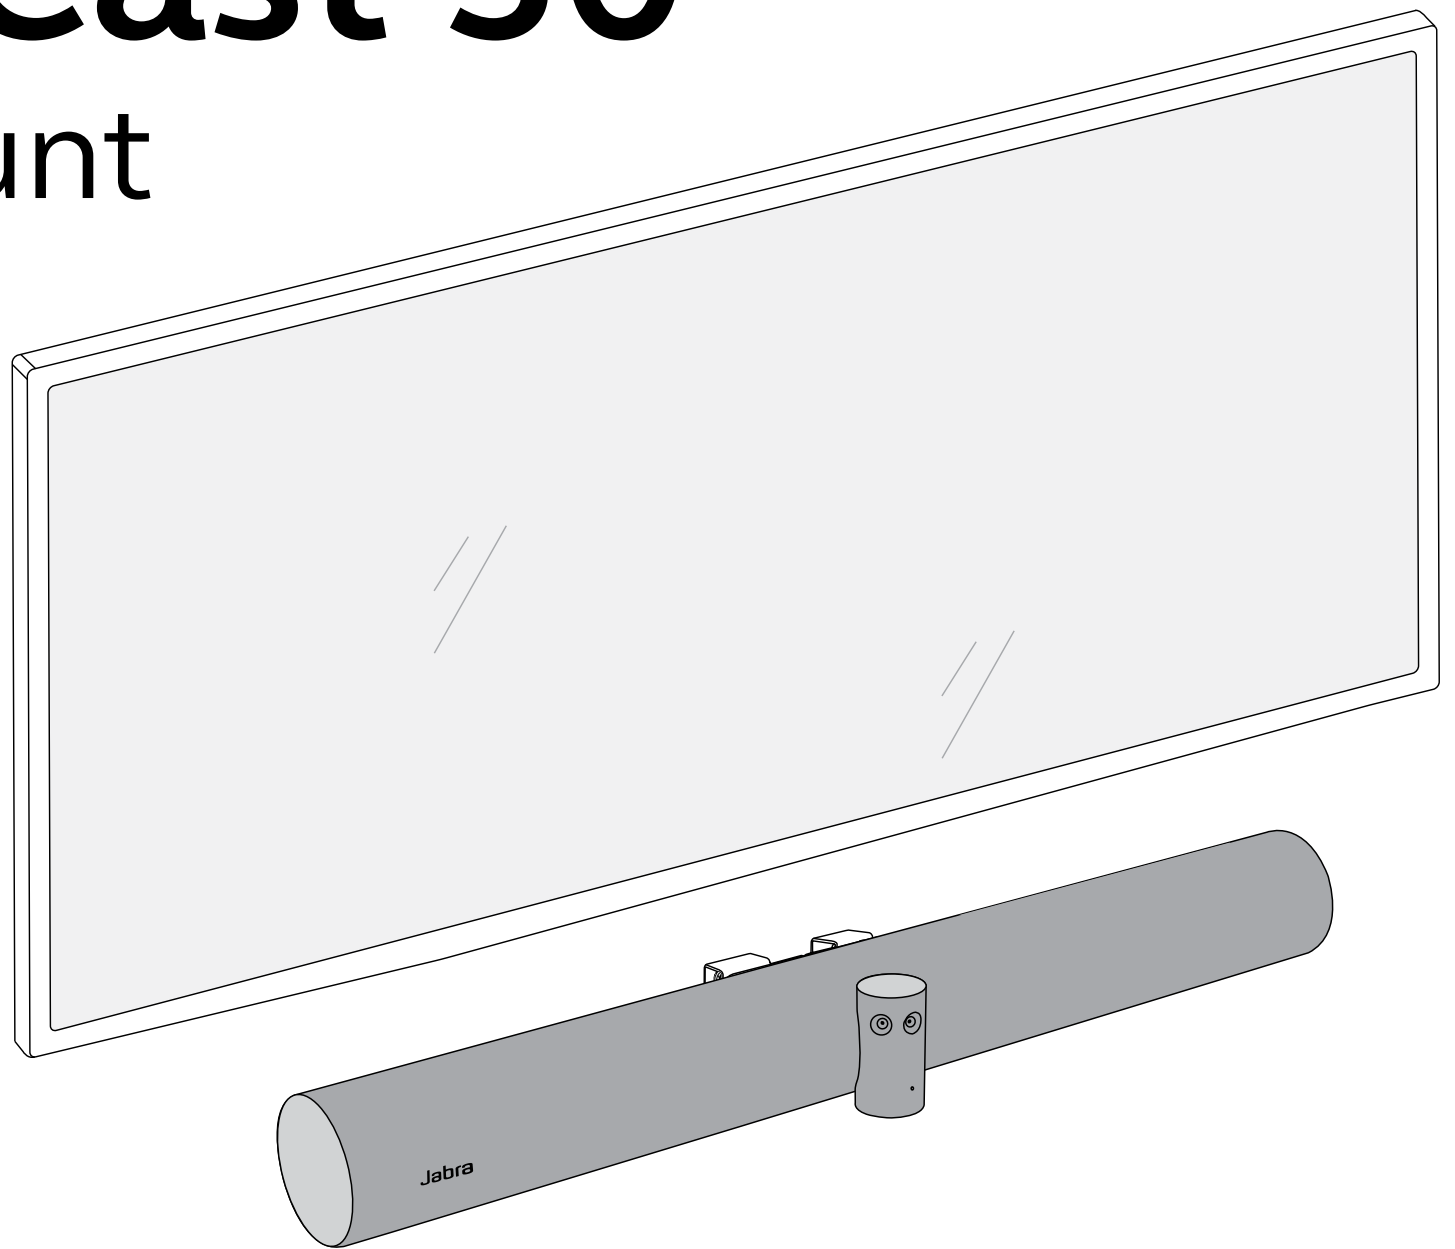


Install above screen


Start from page 6 →

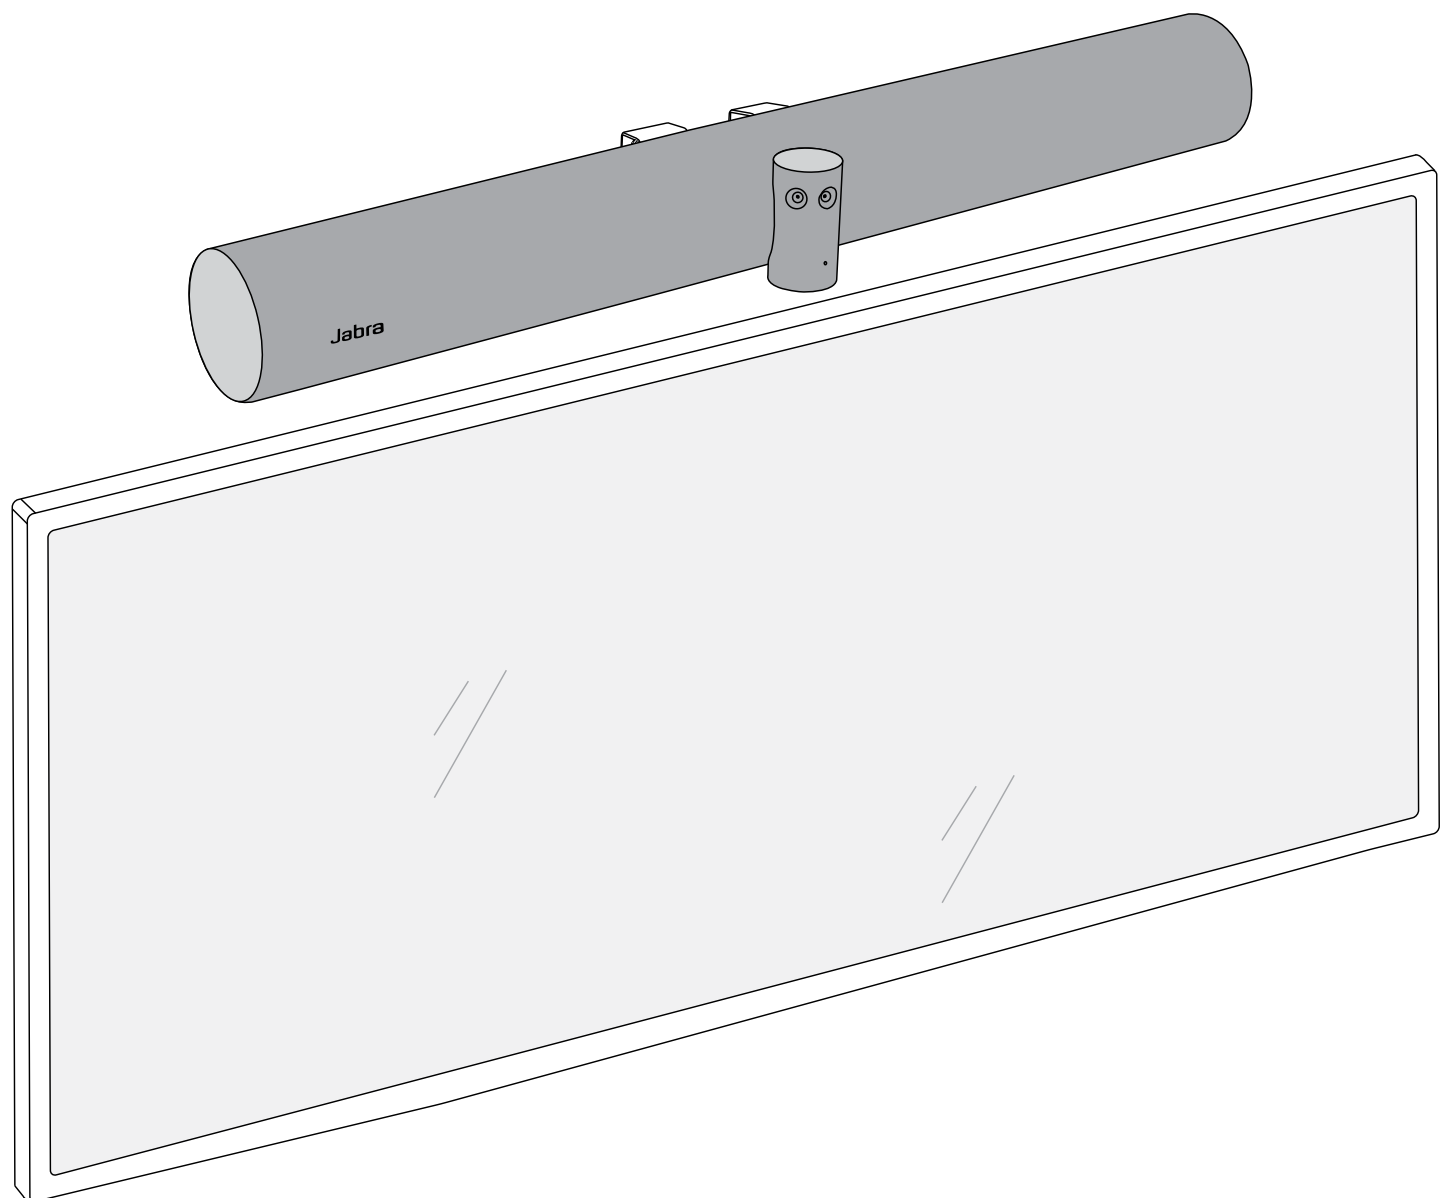

Items included

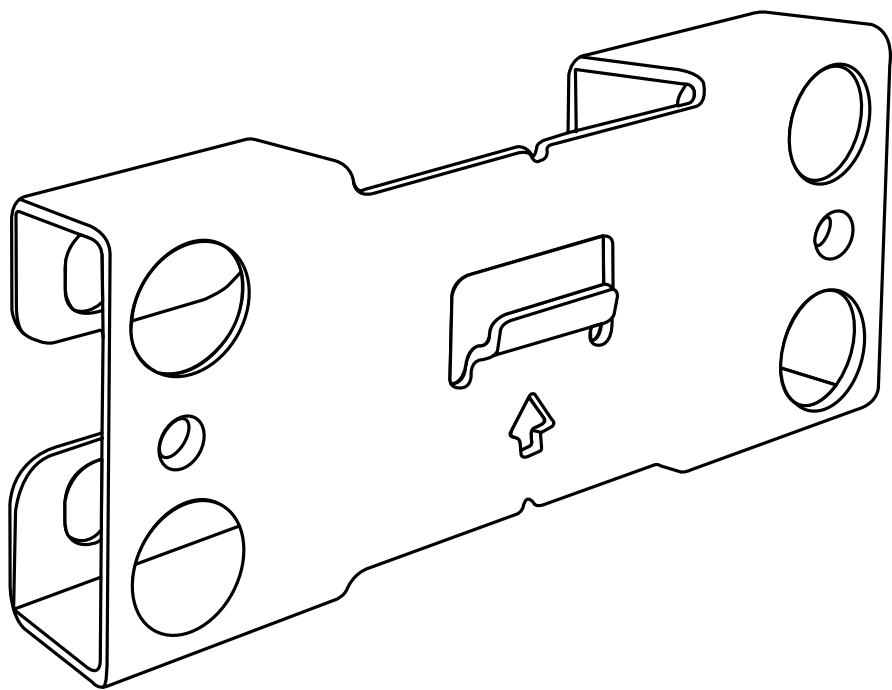


Wall Mount

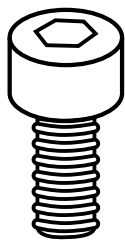


M5x12 Screws
(2pcs)


Tools needed (not supplied in the pack)

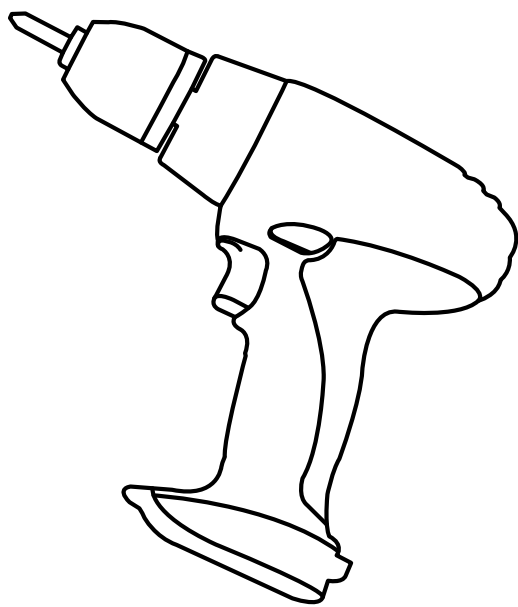


Drill

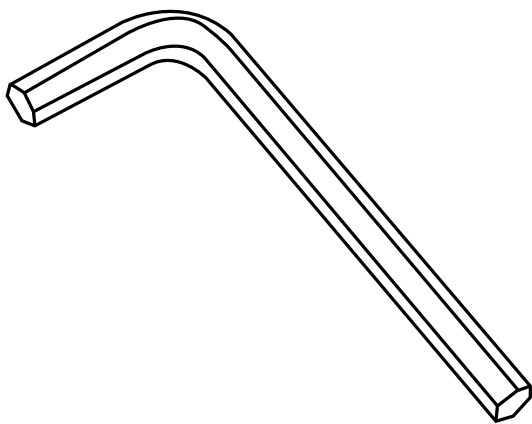

4mm hex key

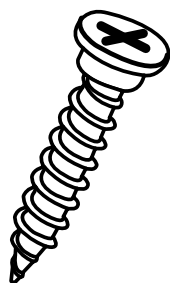



Wall screws

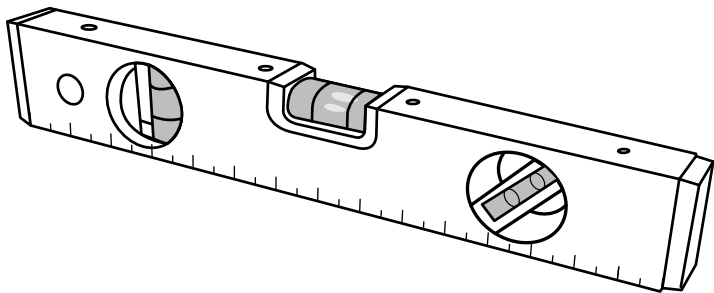

Level



1

Measure **8cm** below the screen for Wall Mount placement. The top of the **Wall Mount** will align with the 8cm.

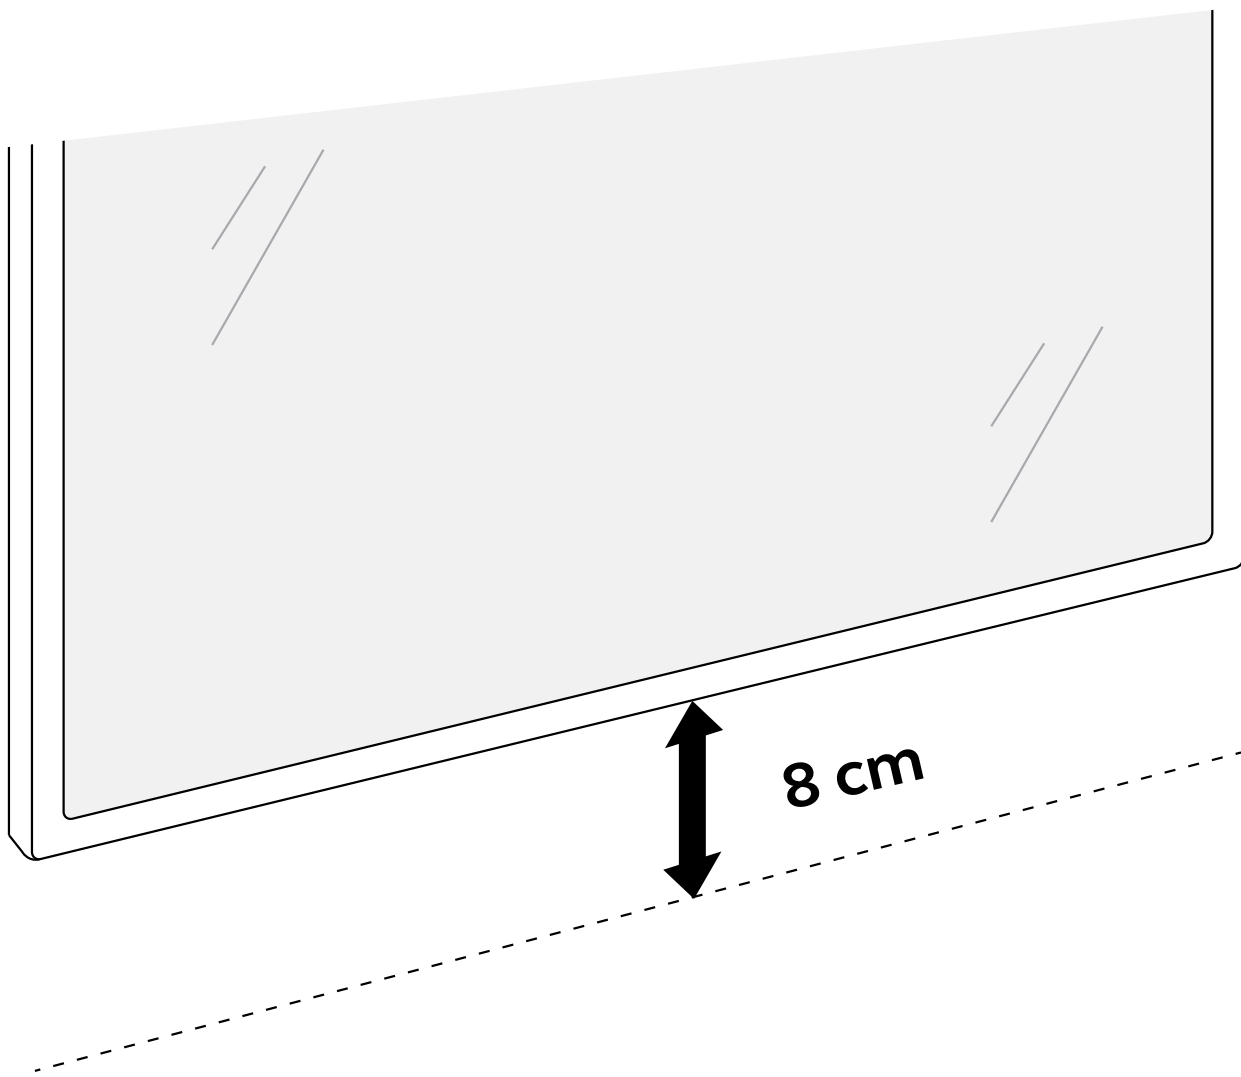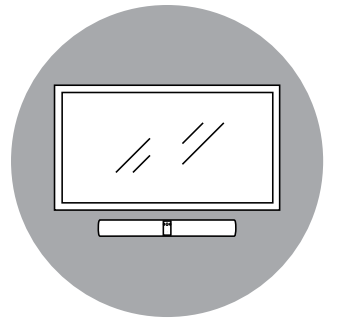



2

Screw the **Wall Mount** to the wall using a drill (screws not supplied).

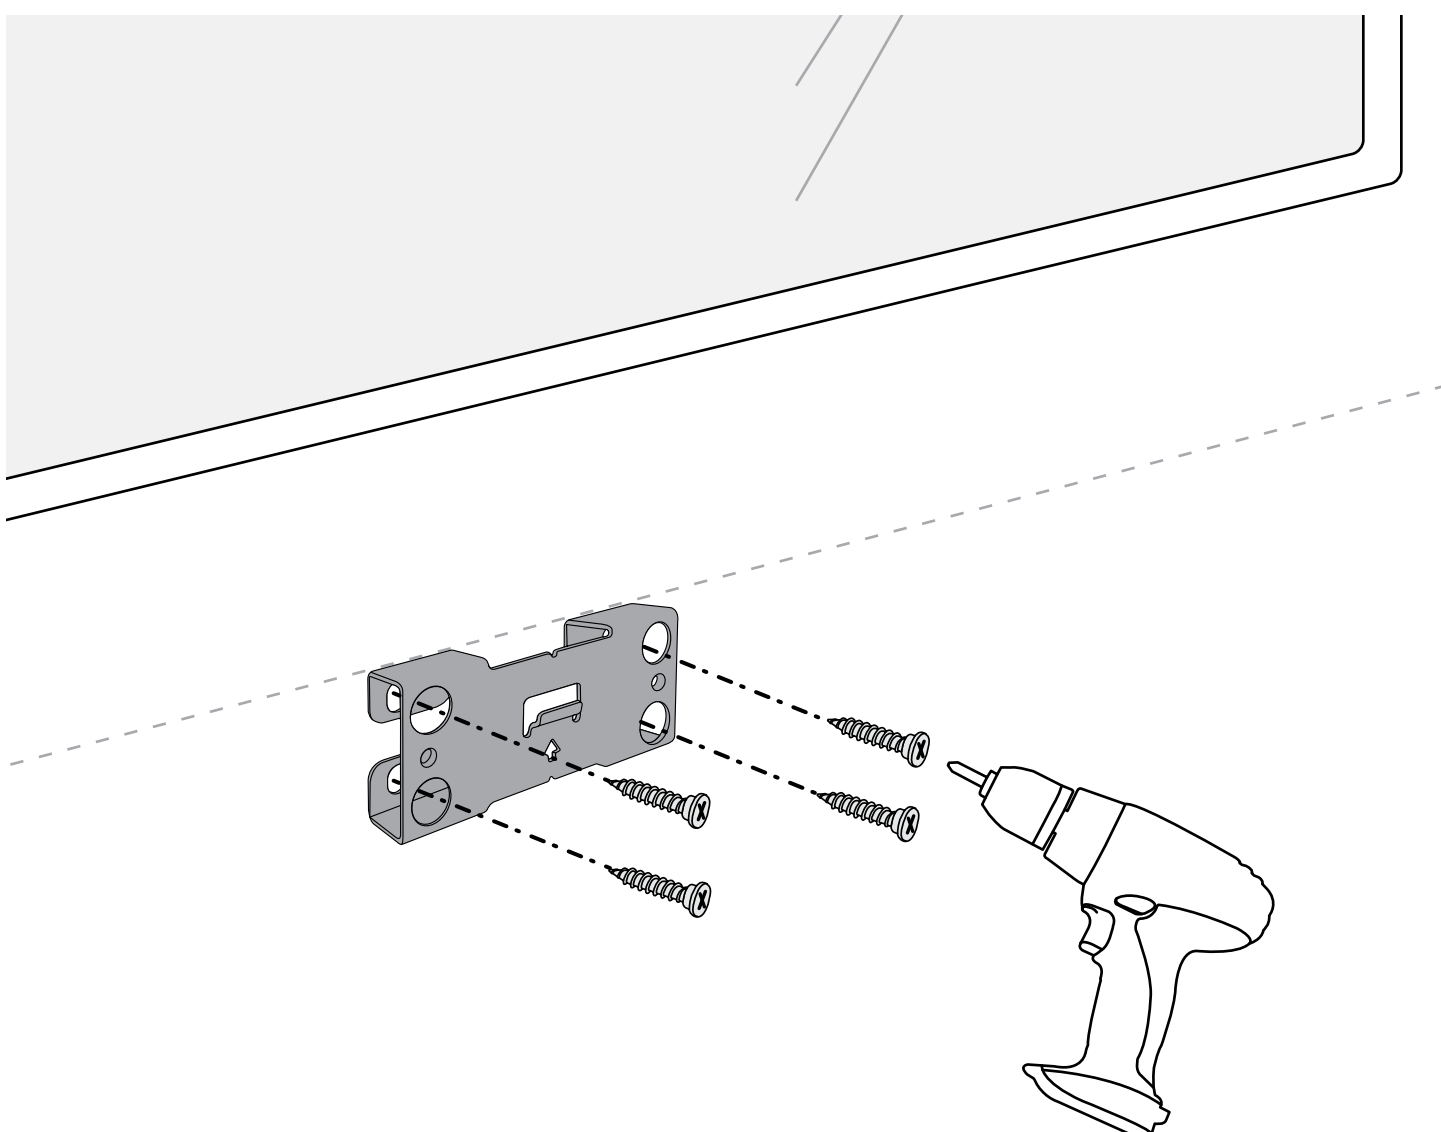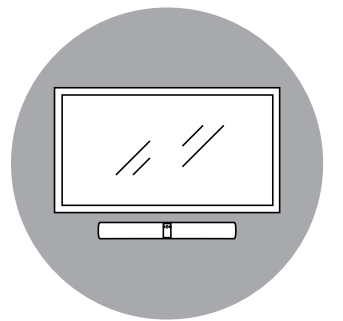



3

Route all relevant cables through the Wall Mount and to the right.

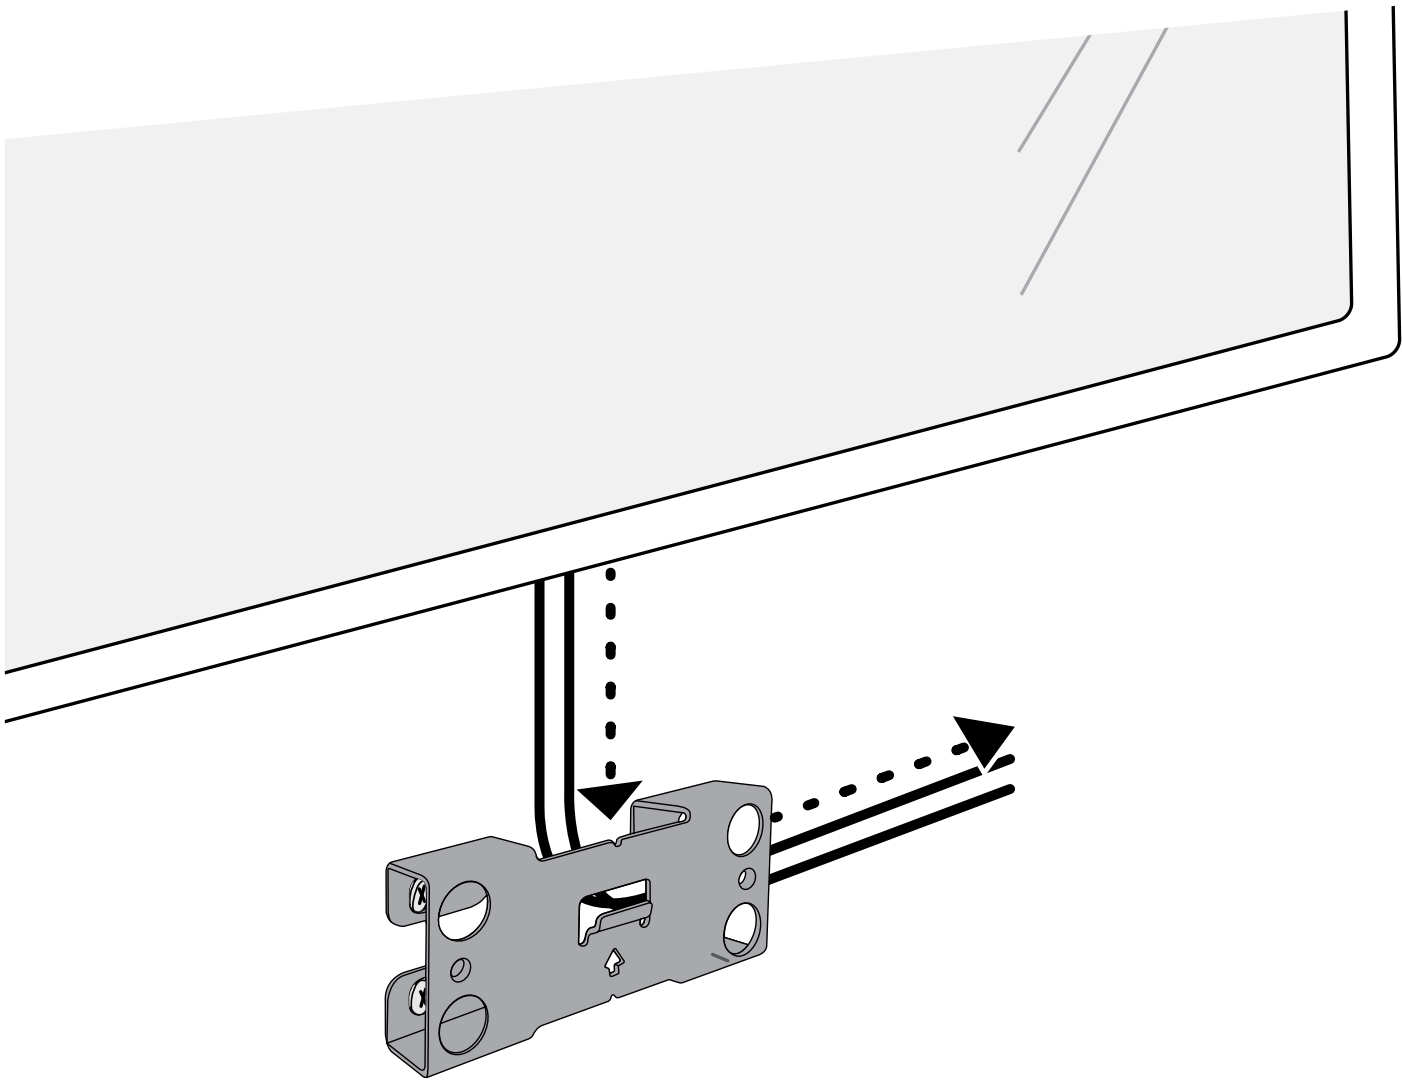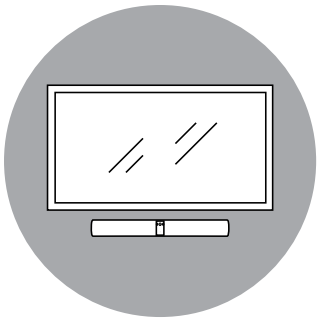



4

Tilt the hinge on the PanaCast 50 for easy access to the screw holes.

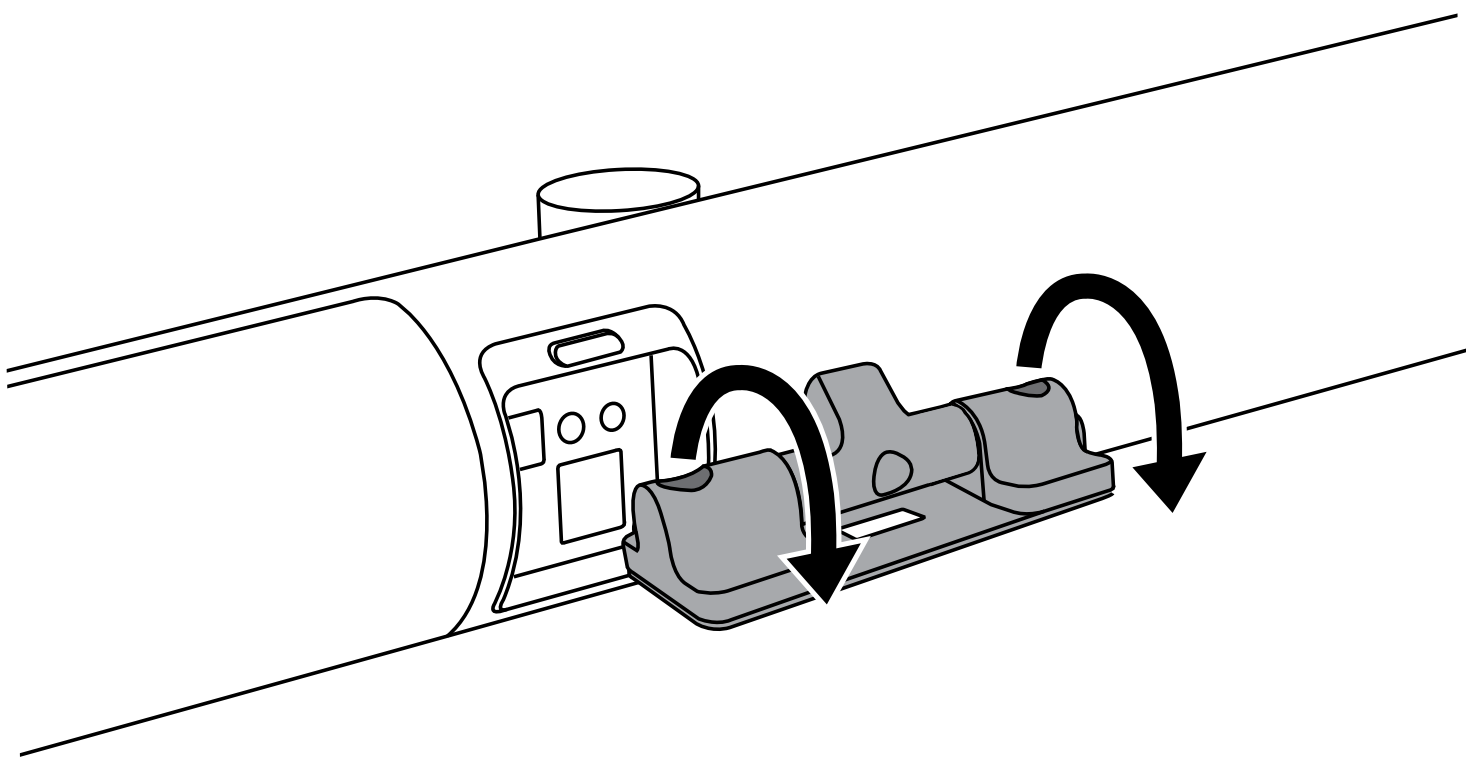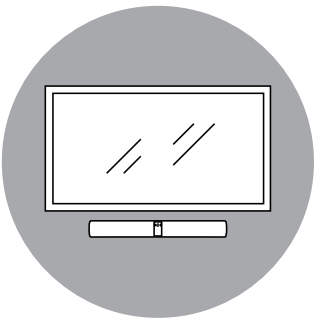



5

Mount and screw the PanaCast 50 to the Wall Mount using the supplied **M5x12 screws** and a **4mm hex key**.

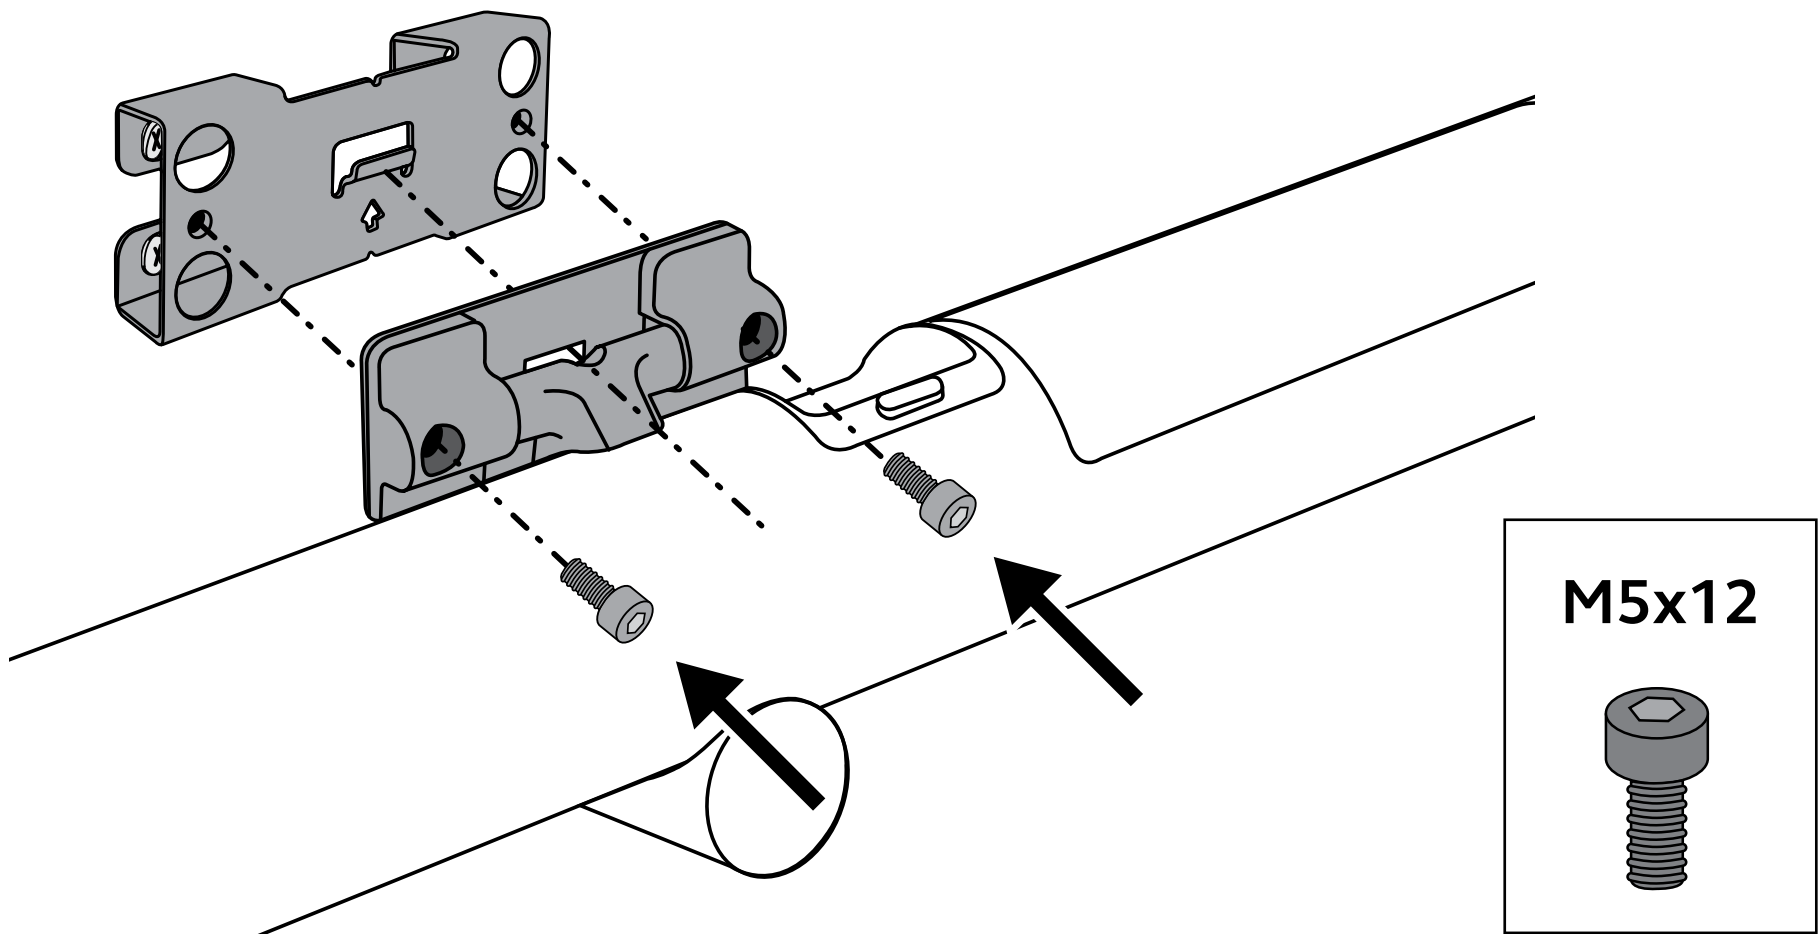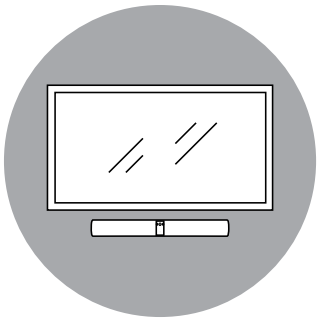



6

Attach the relevant cables to the PanaCast 50.

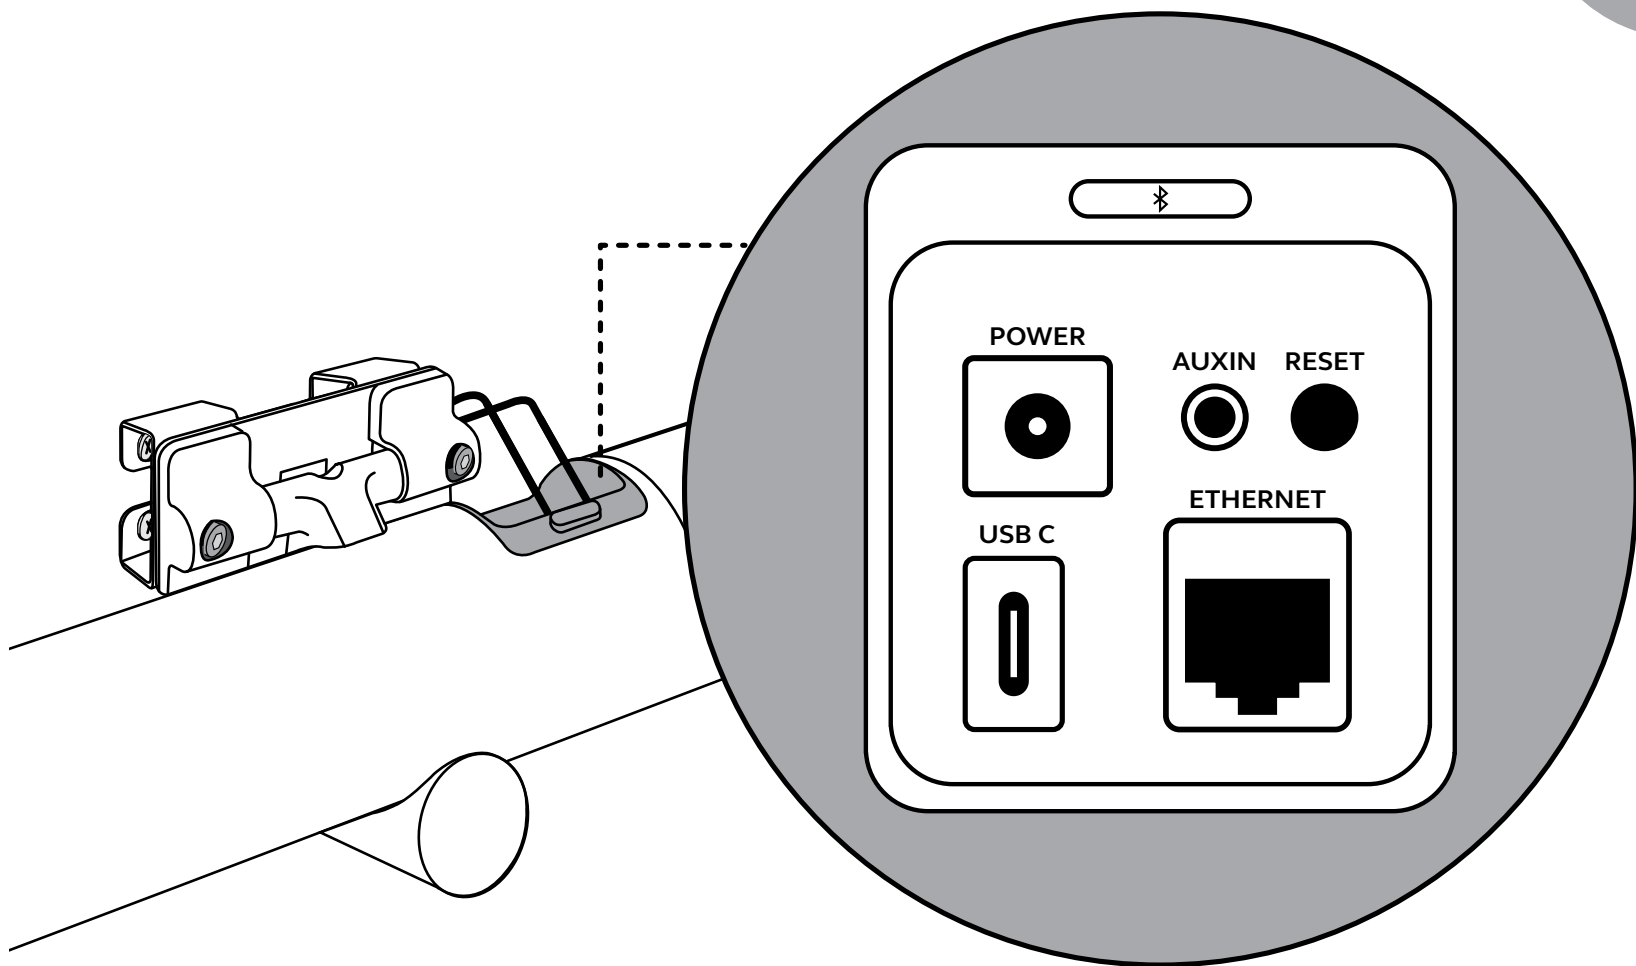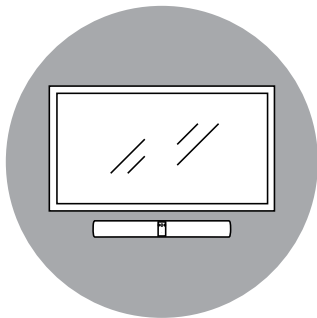



7


If the PanaCast 50 is not level, adjust the angle by loosening the right screw, leveling and re-tightening the screw.

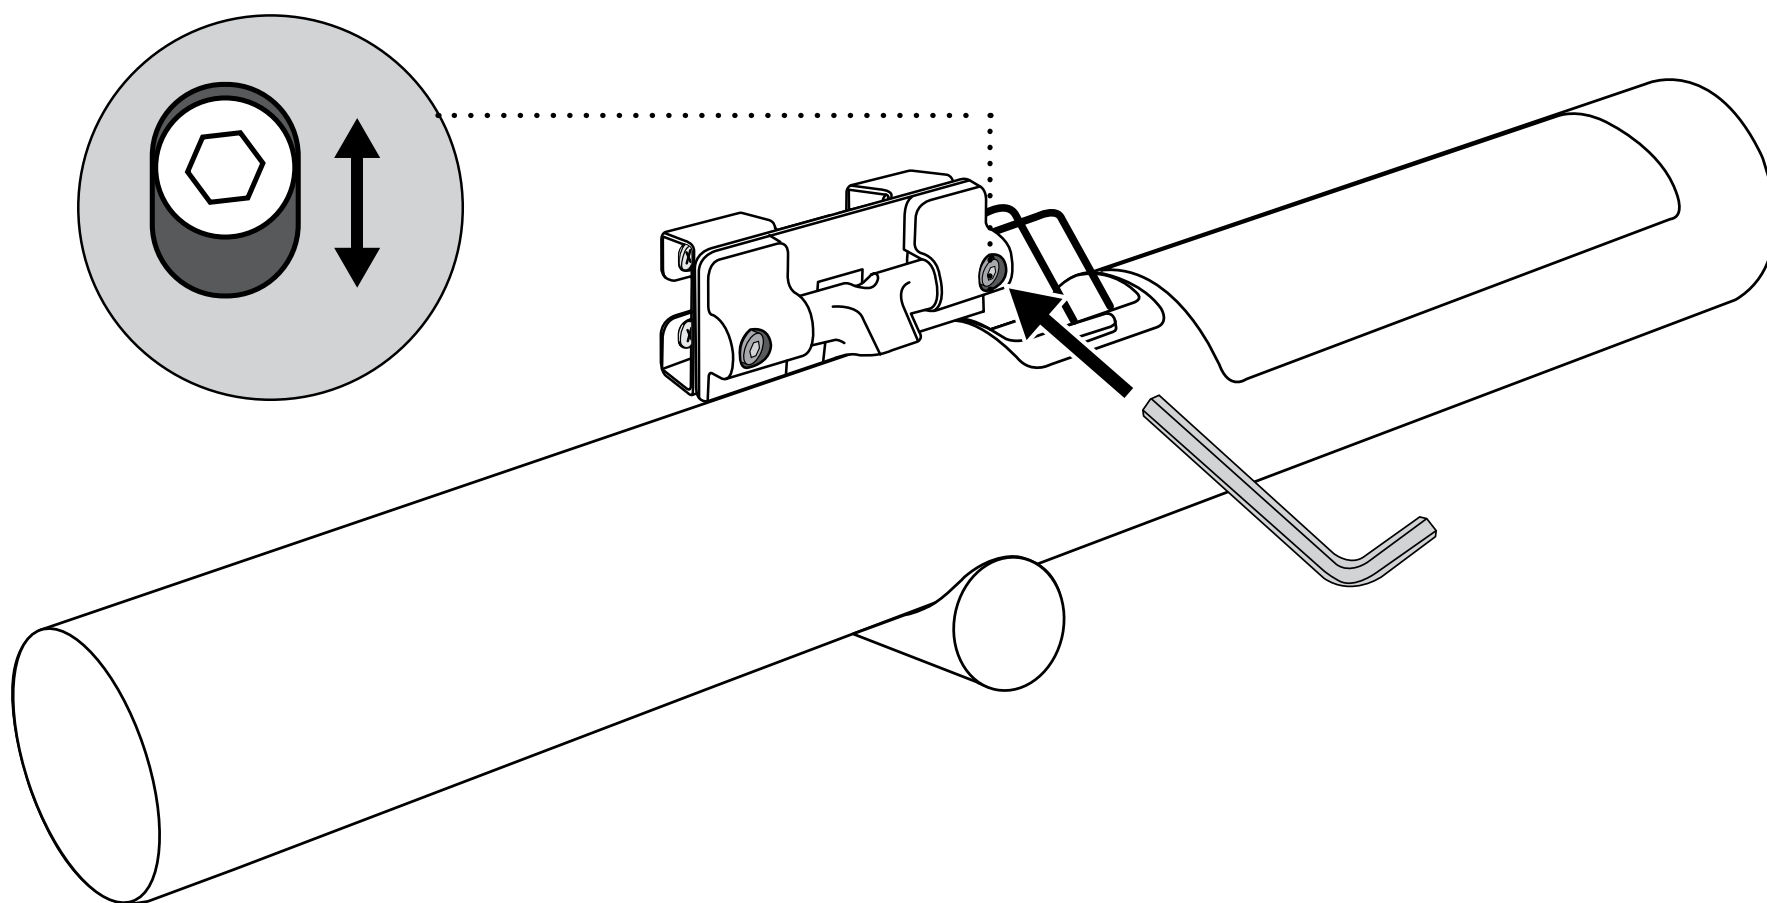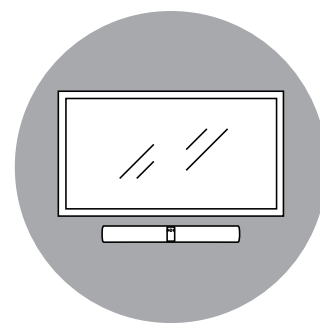

8



Rotate the PanaCast 50 into its final position and angle the camera to point at eye-level.

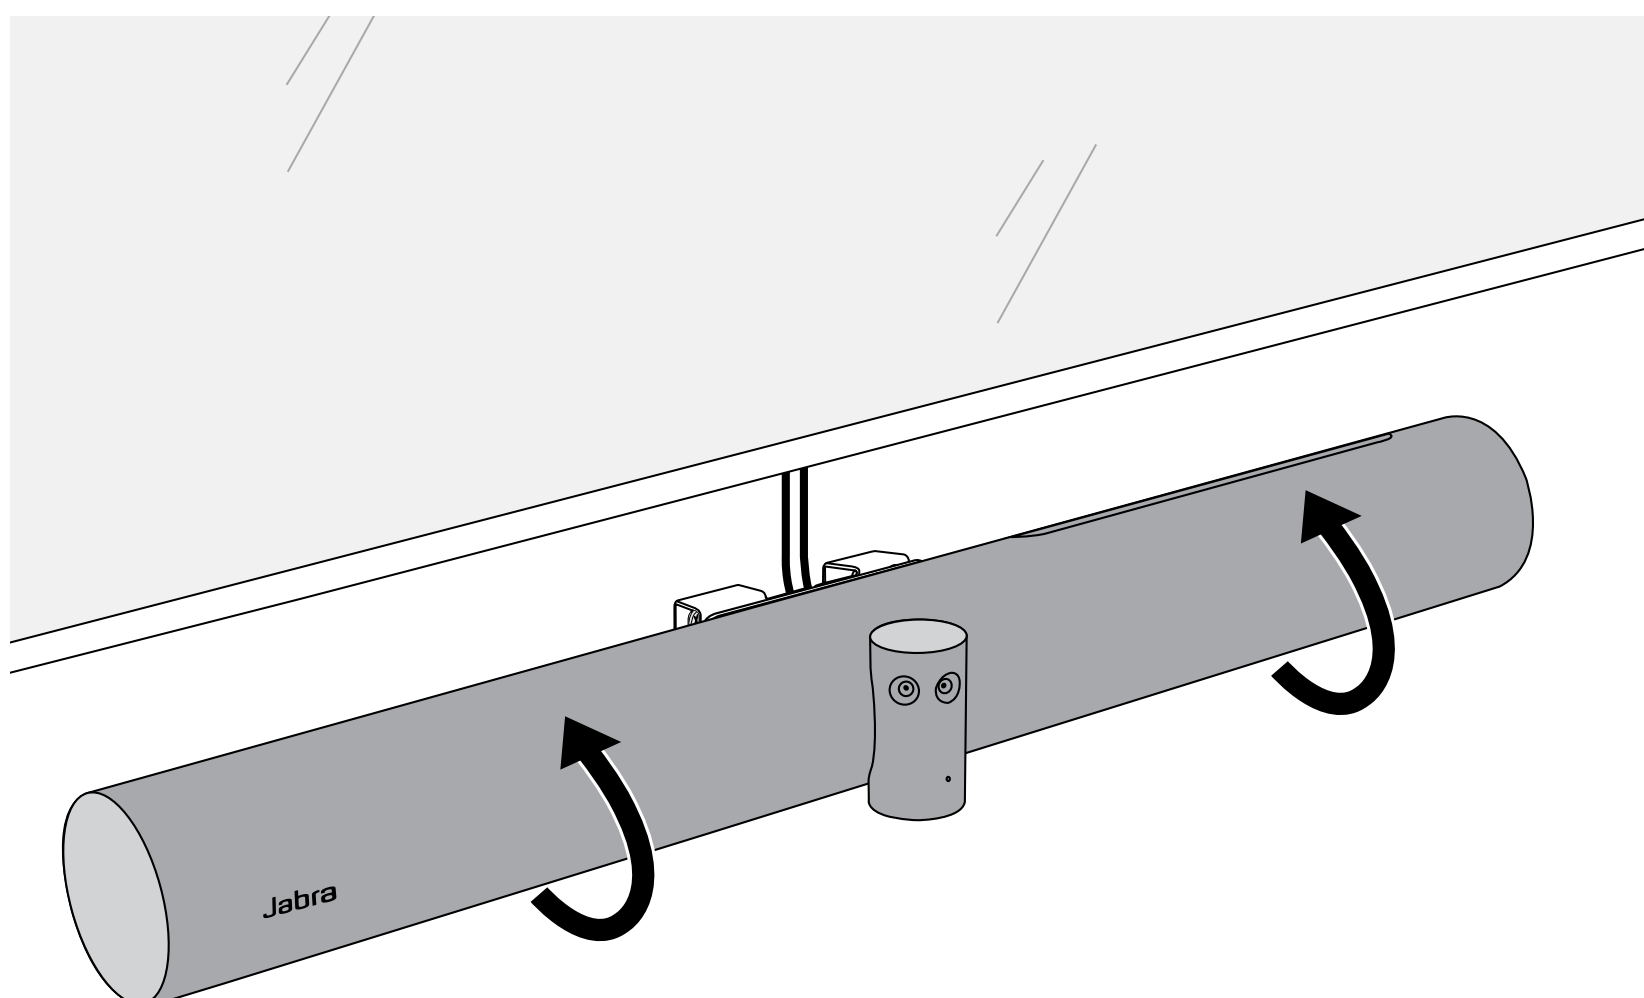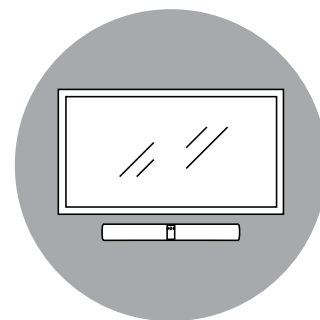

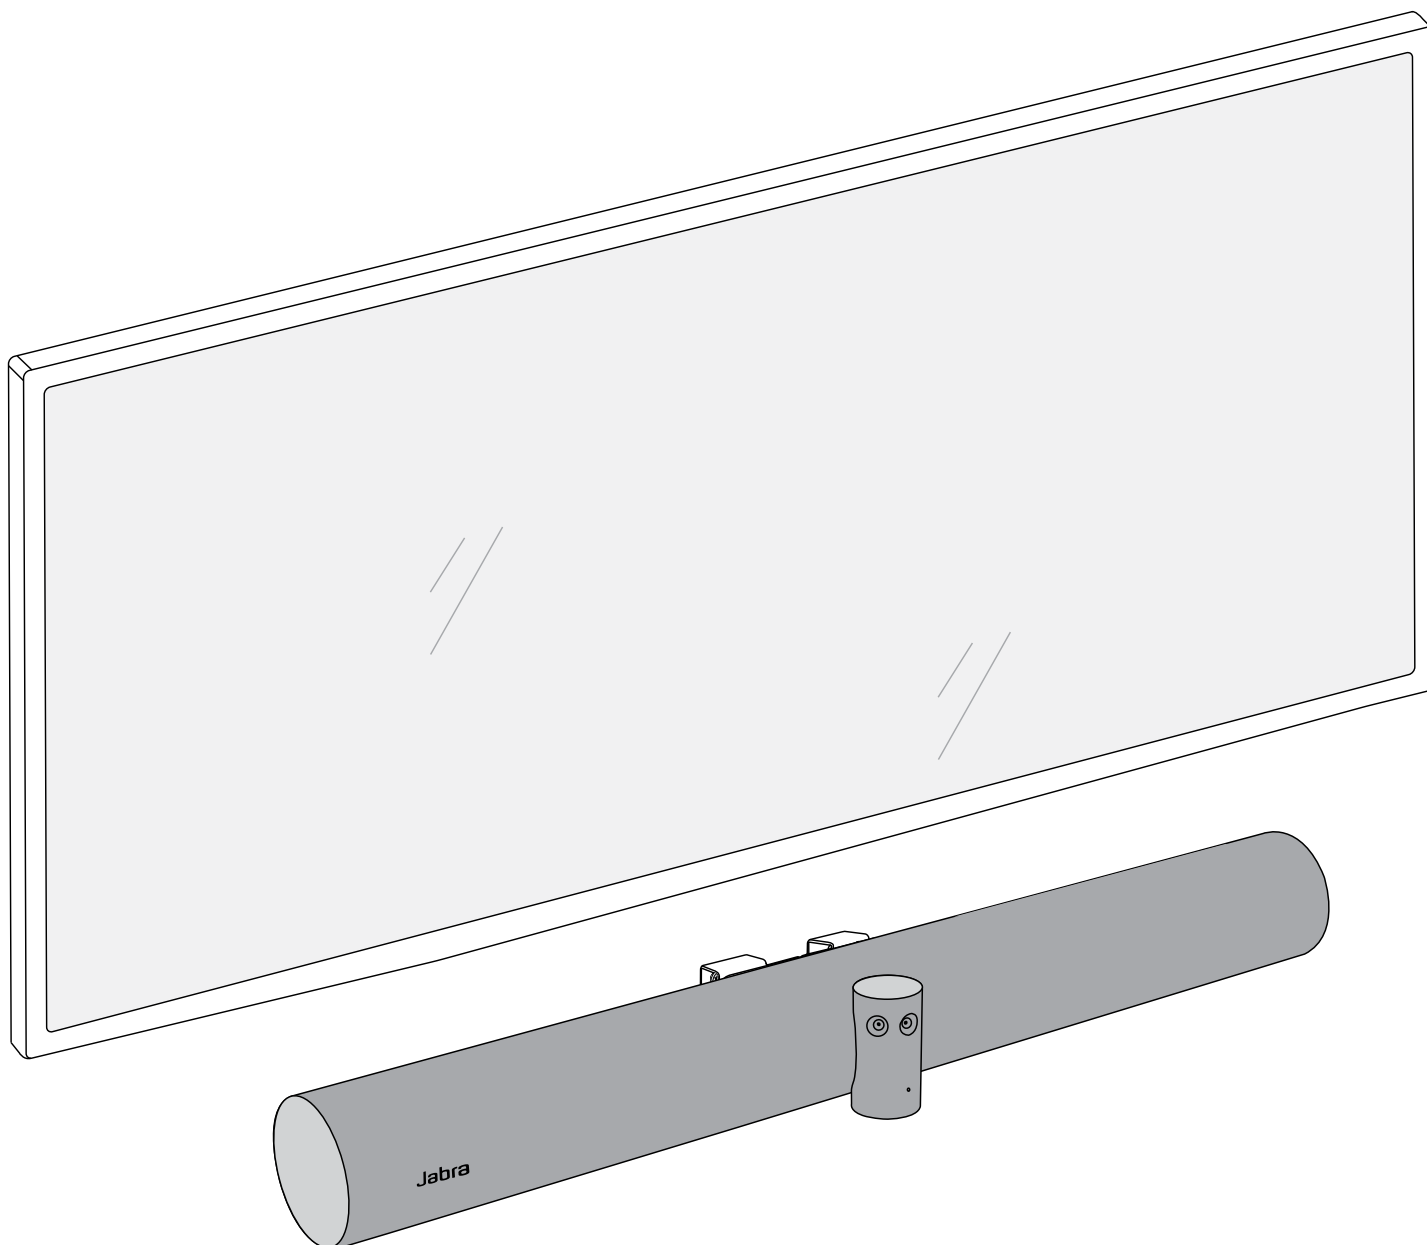



1

Measure **8cm** above the screen for Wall Mount placement. The bottom of the **Wall Mount** will align with the 8cm.

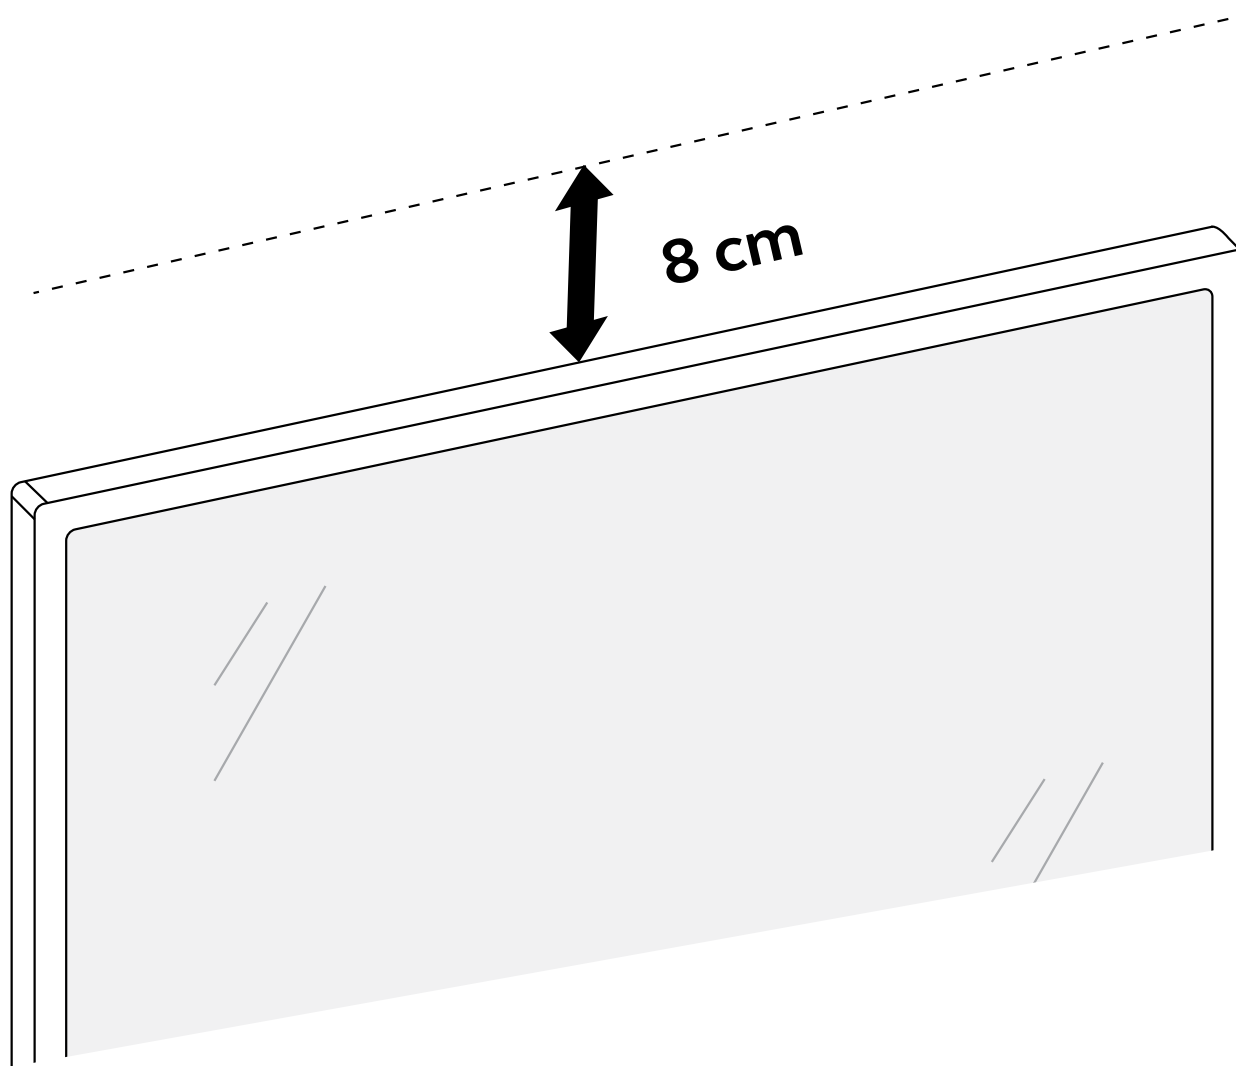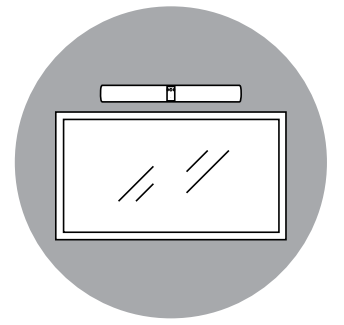



2

Screw the **Wall Mount** to the wall using a drill (screws not supplied).

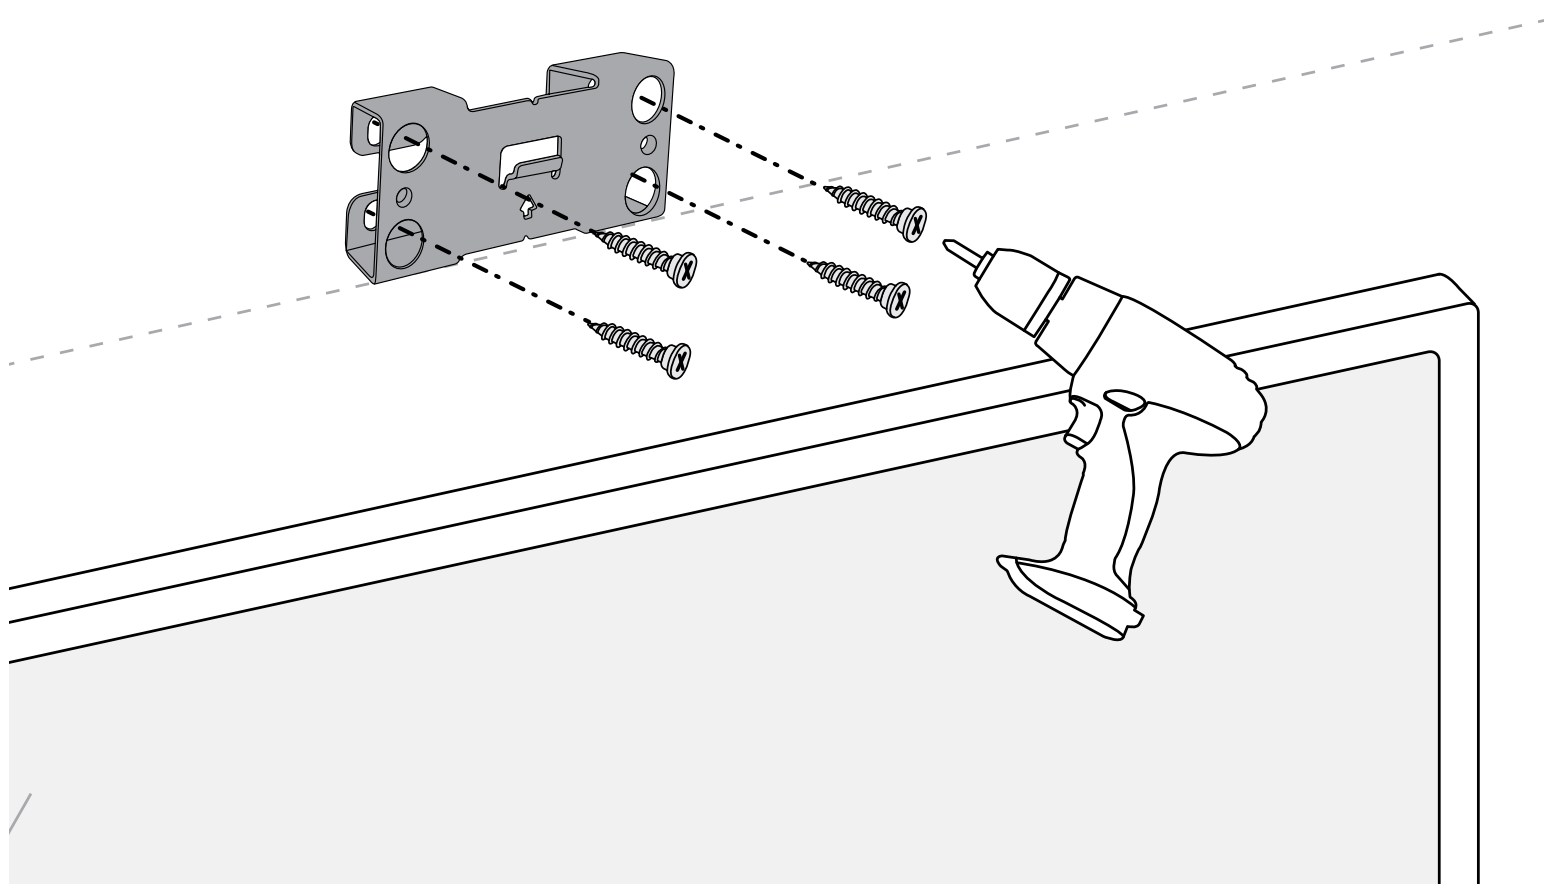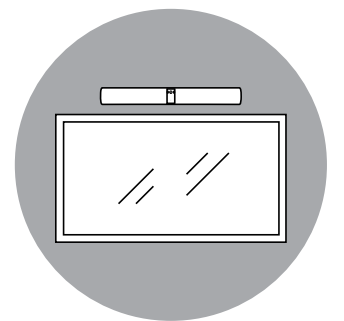



3

Route all relevant cables through the Wall Mount and to the right.

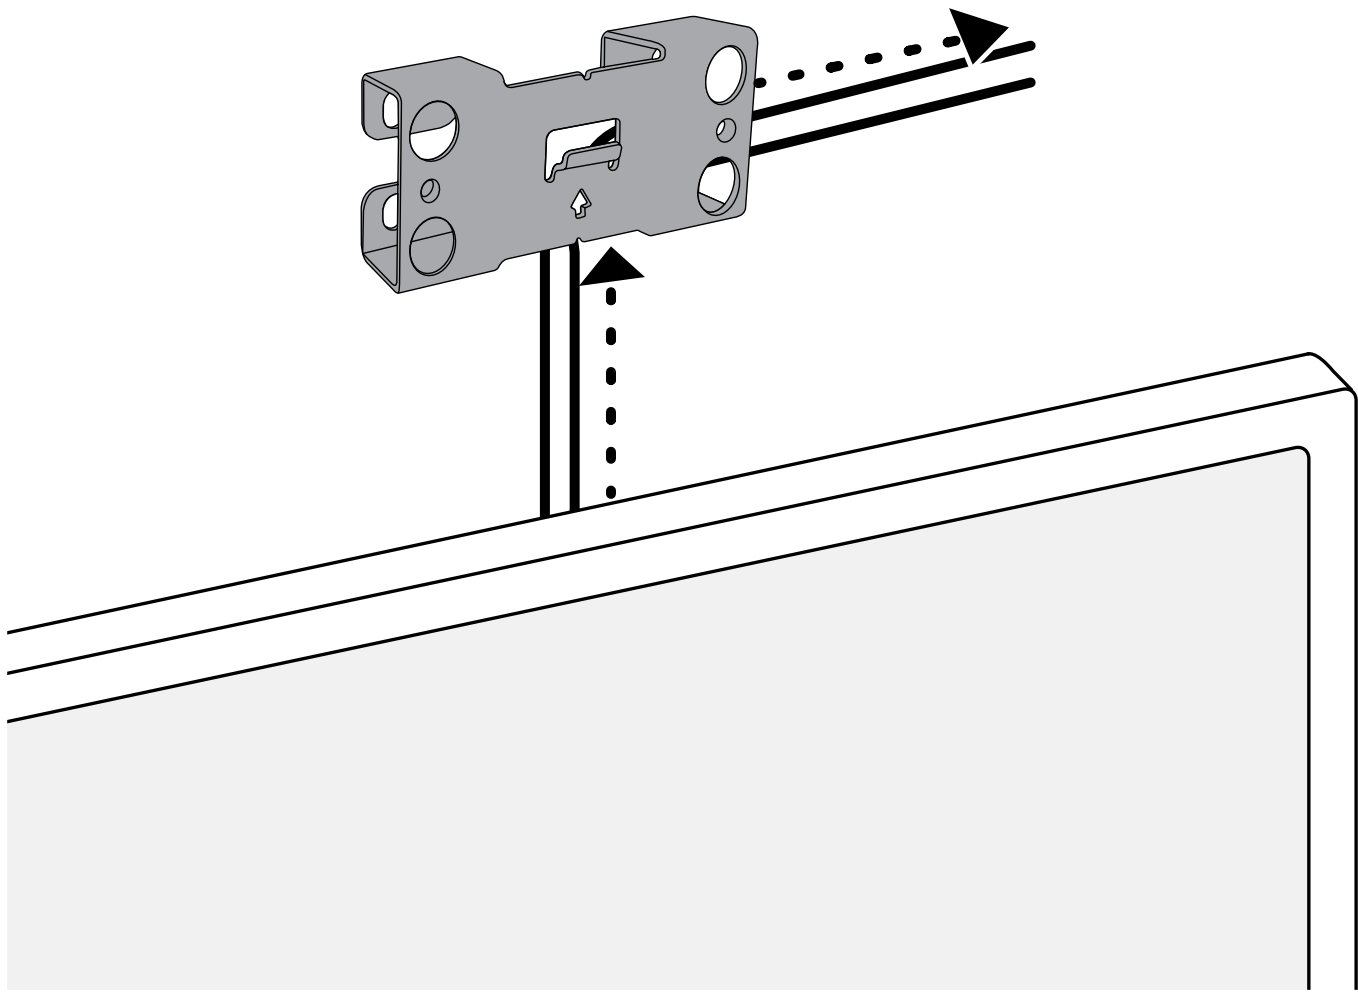
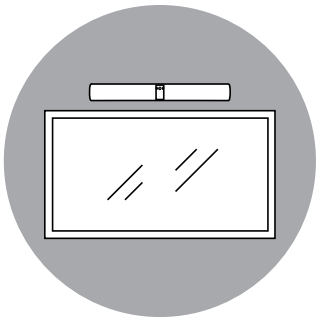


4



Tilt the hinge on the PanaCast 50 for easy access to the screw holes.

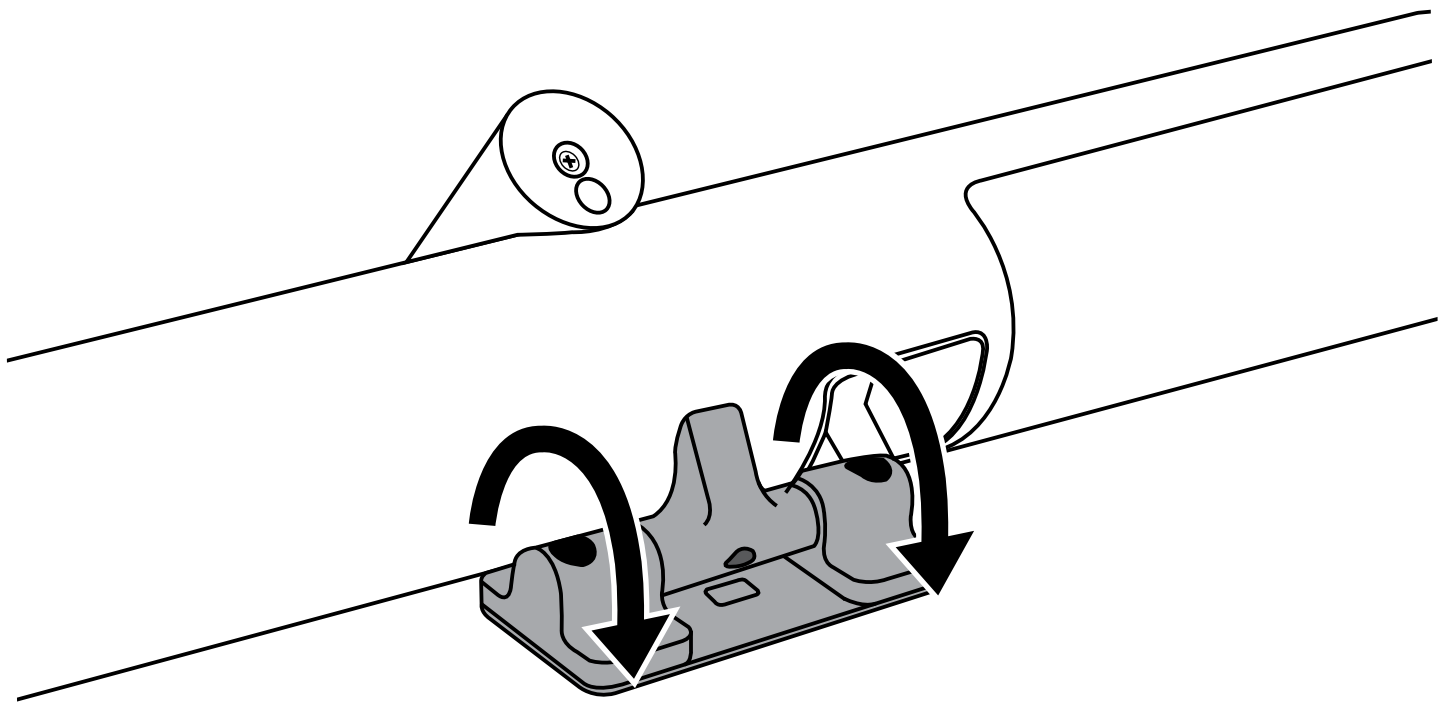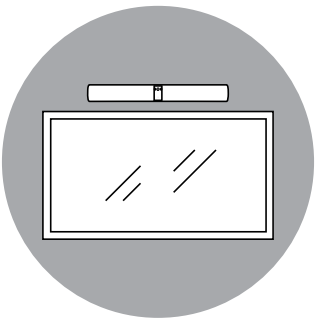


- 5 Attach the relevant cables to the PanaCast 50 before mounting and screwing to the Wall Mount.

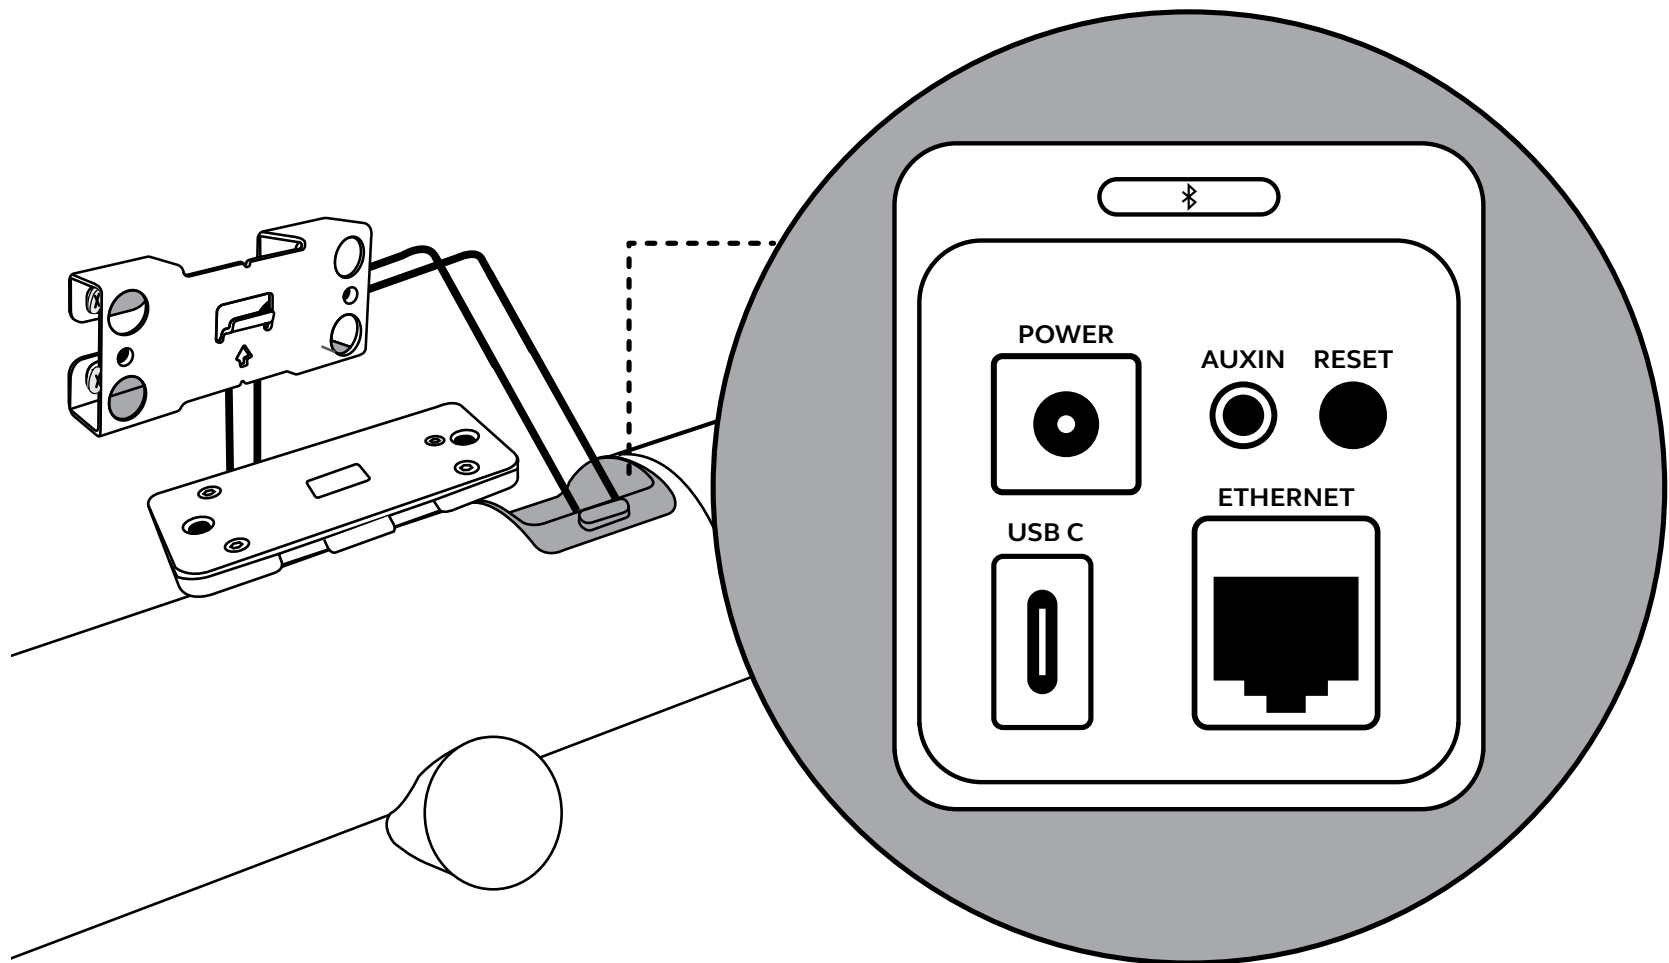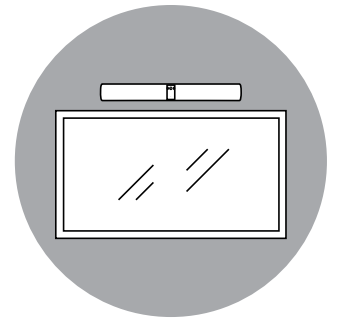

- 6 Mount and screw the PanaCast 50 to the Wall Mount using the supplied **M5x12 screws** and a **4mm hex key**.

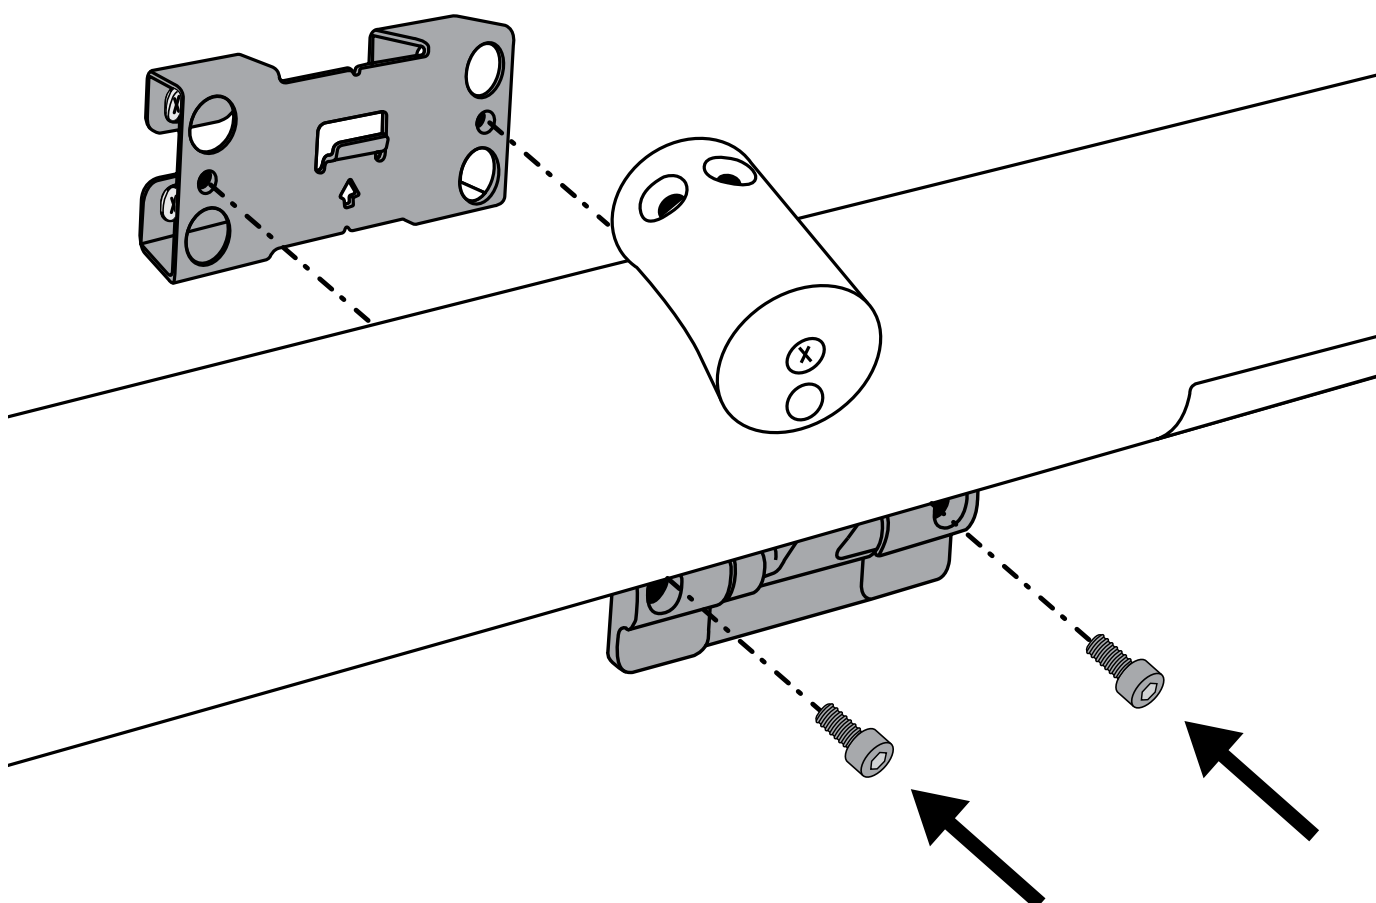
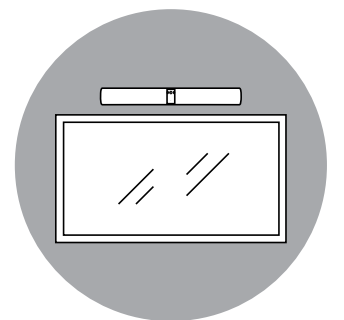


M5x12

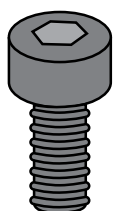

7

If the PanaCast 50 is not level, adjust the angle by loosening the right screw, leveling and re-tightening the screw.

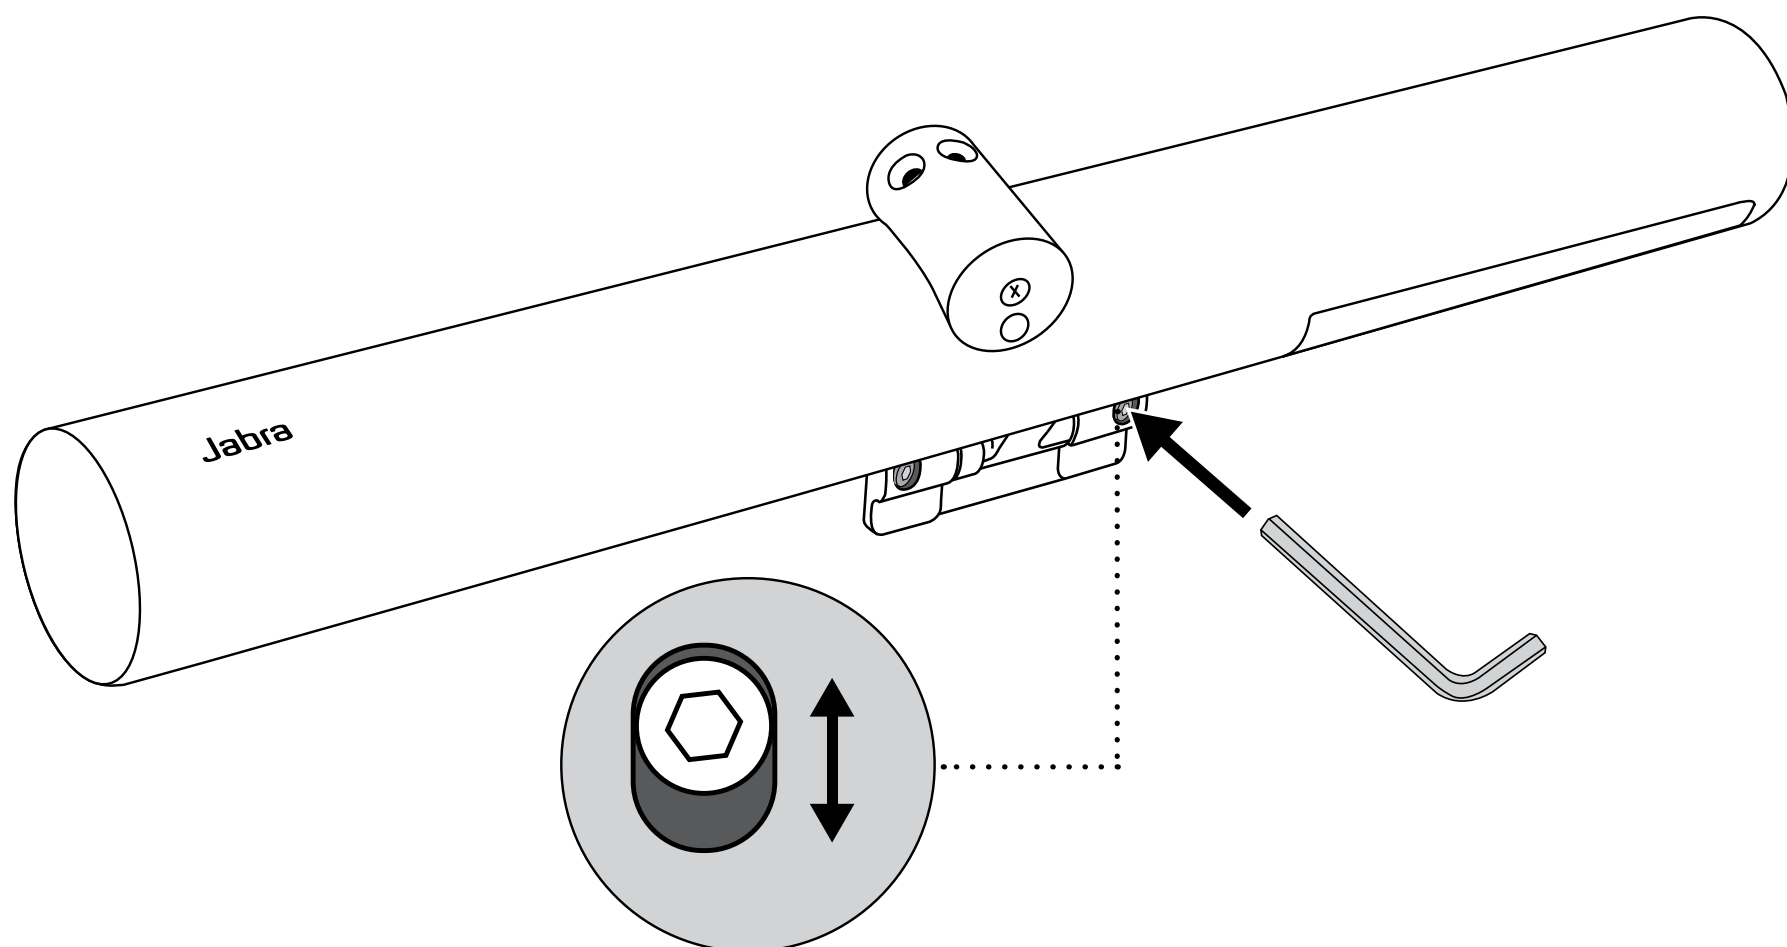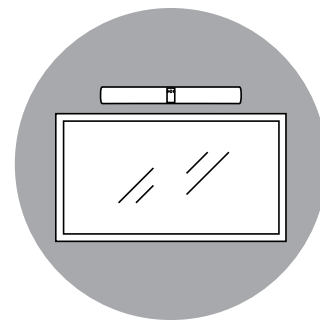

8

Rotate the PanaCast 50 into its final position and angle the camera to point at eye-level.

